

**ENGINEERING CHANGE NOTE:**

mfx3

ECN #:

329

**ASSEMBLY:** BPR**DESCRIPTION:** MW4-BPR Backplane**New Assembly:****DATE:** 17/12/99**Current Assy Rev:****Current Schematic Rev:****New Assy Rev:****New Schematic Rev:**☐ CMS BOMs Updated☐ Excel BOMs Updated☒ Subcontractor Records Updated**Compatibility Maintained:** Yes**IMPLEMENTATION INFORMATION:**☐ Safety Issue☐ UL Compliance Issue☐ New Feature☐ Cost Reduction☒ Bug Fix☐ EMC Compliance Issue☐ Quality Issue☐ Reliability Reasons☐ Software Change☐ Cosmetic Change**REASON FOR CHANGE:**

Incorrect connector footprints on Rev2 PCB

**DETAILS OF CHANGE:**

1. Cut off PCB insertion lugs (polarisers) for connectors that are to be inserted at locations F1, F2, ATX1, ATX2, ATX3 and ATX4.
2. Insert connectors from the side of the PCB that has F1, F2, ATX1, ATX2, ATX3 and ATX4 screen printed on. Align pin 1 of each connector (square hole on connector) with pin 1 on the PCB (square pad) and solder connectors. (The cable polarising lug will point to edge of PCB).