

ECN # 376

Page 1 of 1

**ENGINEERING CHANGE NOTE:**

mfx3

ECN #:

376

**ASSEMBLY:** BMW4011D**DESCRIPTION:** MW4-PXY Dual CPU Card**New Assembly:****DATE:** 26/07/00**Current Assy Rev:** J**Current Schematic Rev:** 4.7**New Assy Rev:** K**New Schematic Rev:** 4.8☒ CMS BOMs Updated☒ Excel BOMs Updated☒ Subcontractor Records Updated**Compatibility Maintained:** Yes**IMPLEMENTATION INFORMATION:**☐ Safety Issue☐ UL Compliance Issue☐ New Feature☐ Cost Reduction☒ Bug Fix☐ EMC Compliance Issue☐ Quality Issue☒ Reliability Reasons☐ Software Change☐ Cosmetic Change**REASON FOR CHANGE:**

Fix arbitration which may cause system to hang.

**DETAILS OF CHANGE:**

1. Reprogram the CPLDs with the new file F05C19\_4.CDF.
2. Place revision resistors (RMD8573 - RES 10K 0.125W 1% SMD0603) as follows;  
R127 - 10k  
R128 - Omit  
R133 - 10k  
R134 - Omit  
R135 - 10k  
R136 - Omit  
R137 - Omit  
R138 - 10k
3. Update documentation and remark PCB with Rev K to reflect the change of assembly.