ECN#

476

Page 1 of 1

ENGINEERING CHANGE NOTE:



ASSEMBLY:	BMW4041D-H	DESCRIPTION	\ :	MW4-QDC	Quad Digi	tal Channe	l Card

ASSEMBLY: B	M W 404 I D-H	DESCRIPTION:	MW4-QDC Quad Digital Channel Card					
New Assembly: B	MW4041D-J	DATE:	17/05/02					
Current Assy Rev: H	1	Current Schematic Rev:						
New Assy Rev: J		New Schematic Rev:						
CMS BOMs Updated	○ Excel BOMs Updated ○	Subcontractor Records Upda	ted Compatibility Maintained: Yes					
IMPLEMENTATION INFORMATION:								
○ Safety Issue	UL Compliance Issue	O New Feature	○ Cost Reduction					
O Bug Fix	O EMC Compliance Issue	O Quality Issue						
• Reliability Reasons	○ Software Change	Cosmetic Change						
REASON FOR CHAN	NGE:							
Some machines wir phase of the startup	± •	owing error message durin	ng the "Initialising Audio/Sync Hardware"					
QDC x IO CARD x - error: CFG ERROR (/XINIT ASSERTED) or								
QDC x IO CARD	x - error: XDONE timeout							
DETAILS OF CHAN	IGE:							
	OR Resistors SMD1206 (FL P/N the nearby via (second down from	,	(FL P/N RMD4379) one from each pad of the ed sketch.					
2. Relabel the Boar	rd so that the Label reads: BMW	4041D-J						

NOTE TO SUBCONTRACTORS: Modify all Boards in Stock and in WIP.

NOTE TO PRODUCTION: Modify all Boards in Stock and in WIP

NOTE TO FIELD SERVICE: Modify the QDC Board(s) if the machine exhibits the problems as described above.